


Bill Baileys Park, Nettleham
Lincolnshire
Tree safety survey
18th July 2024

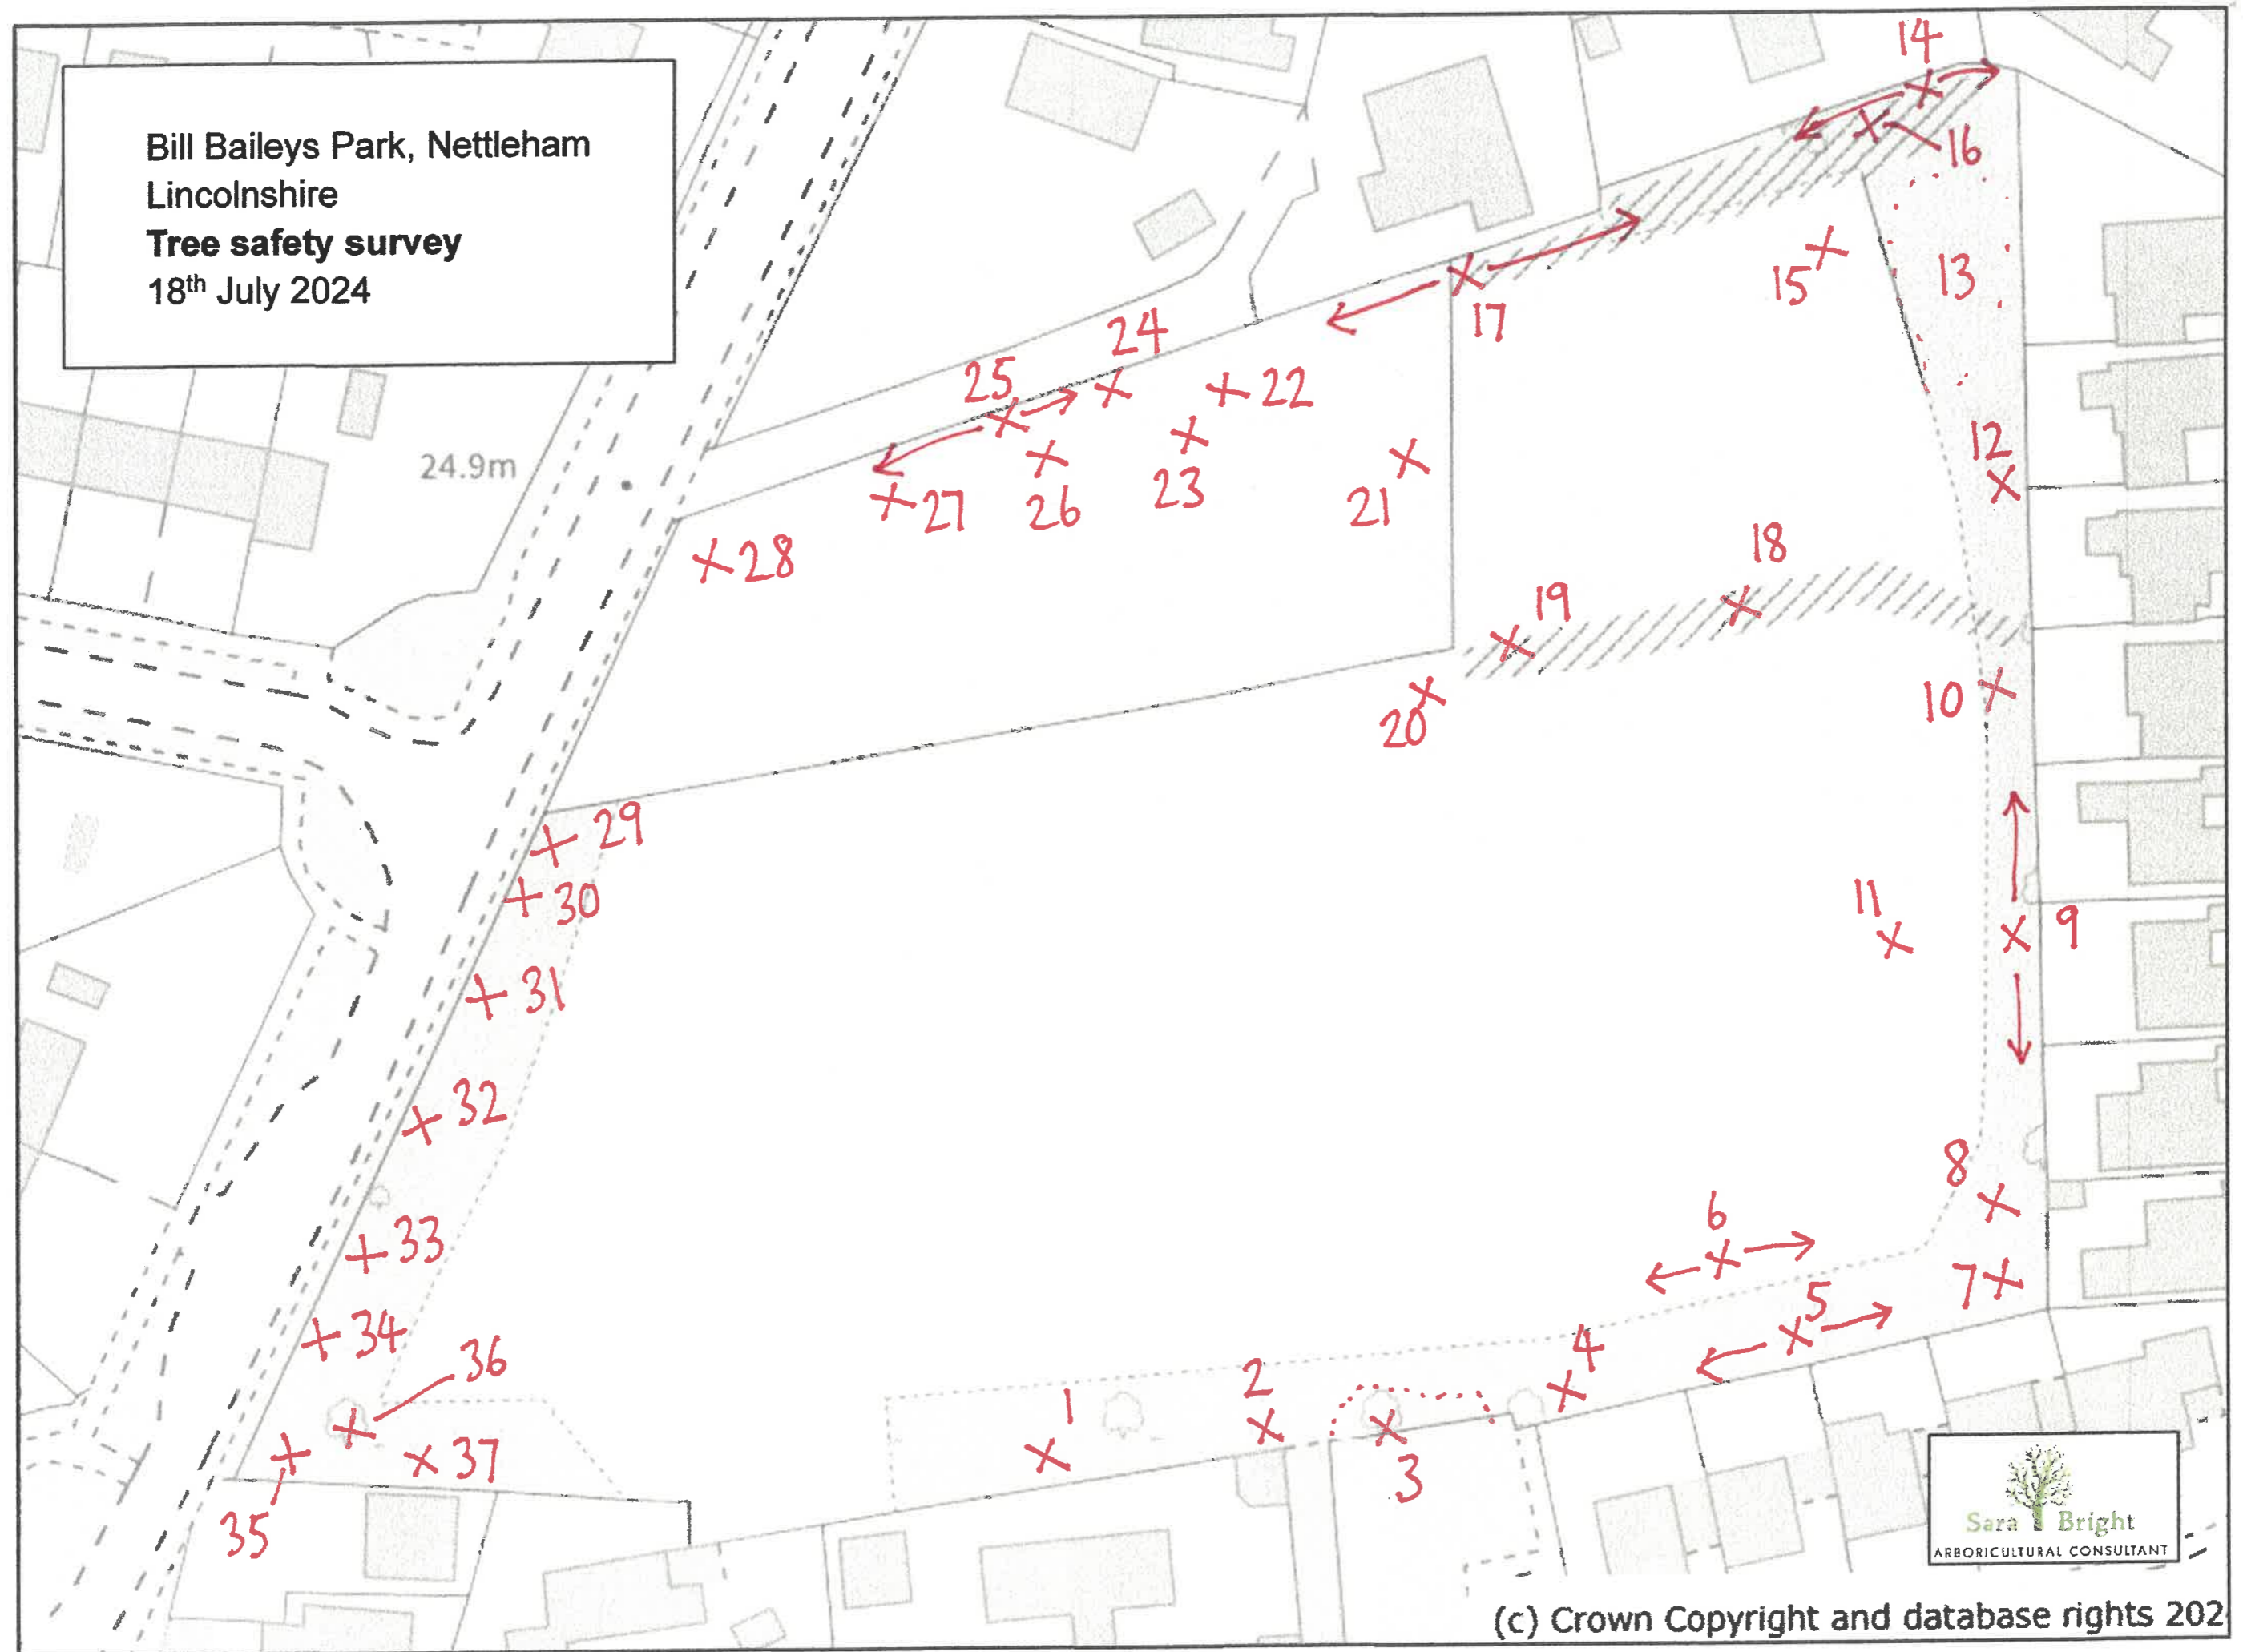

Bill Baileys Park, Nettleham, Lincoln

Tree no	Size band	Species	Age class	Condition/ notes	Work required	Priority	Risk category - Nettleham PC
1	S4	Acer platanoides Norway maple	mature	tree close to boundary, in moderate condition, minor deadwood, branches close to house - not yet an actionable nuisance, poor pruning in past	suggest discuss OHB's with neighbour - could contribute to any pruning	6 months	Yellow
2	S2	Sorbus intermedia	mature	tree in moderate condition, but poor form	no action		Green
3	S2	mixed	mature	unmanaged area of scrub, including Sallow, Hawthorn, Prunus, Elder, low risk	monitor scrub encroachment to signs and grass area	6 months	Yellow
4	S3	Crataegus monogyna Hawthorn	mature	possibly the last tree from old boundary hedge, in rather poor condition; ivy clad stems, poor structure, 2 main stems slowly splitting apart, some deadwood, has been pruned back from neighbour	sever ivy, pollard stems at approx 4.5m - at appropriate point	3 months	Red
5	S2	mixed	mature	unmanaged planting along field margin and boundary, including Hazel, Prunus, Elder, Birch, OHB's to neighbour - not actionable	no action		Green
6	S2	Acer species	semi mature	row of 4 planted trees, in moderate condition	no action		Green
7	S4	Acer campestre Field maple	mature	tree in moderate condition, high OHB's to neighbour - not actionable, minor deadwood	no action		Green
8	S4	Acer campestre Field maple	mature	tree in moderate condition, high OHB's to neighbour - not actionable, minor deadwood	no action		Green
9	S2	mixed	mature	unmanaged 'hedge' along boundary, mostly Hawthorn with shrub species, OHB's to neighbours	suggest reduce to approx 3m and 'side up', ensure clear of fence, discuss with neighbours; not yet an actionable nuisance but may be in the long term	winter 2024/25	Yellow
10	S3	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, high OHB's to neighbour - not actionable	no action		Green
11	S2	Betula pendula Birch	mature	row of 3 planted trees, in moderate condition	continue to protect from mowers and strimmers	ongoing	Yellow
12	S2	Crataegus monogyna Hawthorn	mature	group of unmanaged Hawthorn along boundary, in rather poor condition; ivy clad stems, OHB's to neighbours, some dead stems	sever ivy on biggest stems, suggest pollard at approx 2m in winter to regenerate, discuss with neighbours	winter 2024/25	Yellow
13	S3	mixed	mature	copse including Ash, Alder, Prunus, Hawthorn, in moderate condition, but poor forms, soil compaction, ivy on stems, some low target deadwood	spread woodchip from any tree work on root plates	ongoing	Yellow
14	S2	Hawthorn & Elder	over mature	remnant old hedgeline, in poor condition; ivy clad, poor forms, soil compaction on bank, ivy lumps overhanging neighbour	sever ivy, deal with any failures 'as and when'	3 months	Yellow
15	S2	Alnus x Spathelii	semi mature	group of 3 planted trees, in moderate condition, being partly suppressed by neighbouring trees	no action		Green
16	S3	Fraxinus excelsior Ash	mature	appears to be in moderate condition; ivy clad stem, some thin foliage, high OHB's to neighbour	sever ivy	3 months	Red
17	S2	Crataegus monogyna Hawthorn	mature	unmanaged old boundary hedge, with Prunus, Elder etc establishing on bank, some ivy clad stem, deadwood, close to neighbour	suggest discuss any management with neighbour - could contribute to any work	1 year	Yellow
18	S2	mixed	semi mature	group of planted trees in the old court area and bank, in moderate condition, have protection	continue to protect from mowers and strimmers	ongoing	Yellow
19	S2	Prunus species	mature	2 trees in moderate condition, some stem cavities and decay, minor deadwood, mower damage to roots	discuss best practice mowing and strimming practice with contractor	asap	Red
20	S2	Betula pendula Birch	mature	tree in rather poor condition; suppressed	no action		Green
21	S4	Acer saccharinum Silver maple	mature	group of 3 trees growing co-dependently, in moderate condition, some small lower branches to gate, minor deadwood, mower damage	discuss best practice mowing and strimming practice with contractor, lightly prune to clear gate by 1-2m	3 months	Red

22	S3	Prunus species	mature	tree in moderate condition, stem burl, minor deadwood	no action		
23	S3	Prunus species	mature	tree in moderate condition, some stem bleeding, reactive growth, minor deadwood	no action		
24	S2	Quercus robur Oak	semi mature	2 planted trees either side of swings, damaged by mowers	instruct contractors to fit strimmer guards at their cost	asap	
25	S2	mixed	mature	boundary hedge being maintained	no action		
26	S4	Robinia	mature	tree in moderate condition, biforcates at 2m, minor deadwood	no action		
27	S3	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, minor deadwood, some branches getting close to climbing frame	prune back overhanging branches by approx 2m to clear	3 months	
28	S2	Quercus species Oak	young	3 planted trees, have been ring barked by strimmers, in terminal decline, unacceptable damage by contractor	instruct contractors to remove dead trees and replace at their cost (ensure strimmer guards fitted to new trees)	asap	
29	S4	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, ivy clad stem, has been electric line cleared, minor deadwood	sever ivy	6 months	
30	S1	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, large area of old stem damage on western side of stem, has been electric line cleared, minor deadwood	no action		
31	S4	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, has been electric line cleared, minor deadwood, some small branches encroaching on sign and path	lightly prune to clear by approx 1m	3 months	
32	S4	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, ivy on stem, has been electric line cleared, minor deadwood	sever ivy	6 months	
33	S3	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, biforcates at 2m, minor deadwood and ivy on stem, has been electric line cleared	no action		
34	S3	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, minor deadwood, old pruning wound cavities, has been electric line and pole cleared	no action		
35	S4	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, biforcates at 2.5m, minor deadwood	no action		
36	S4	Acer pseudoplatanus Sycamore	mature	tree in moderate condition, some low target deadwood	no action		
37	S4	Prunus species	mature	tree in rather poor condition; 3 main stems from 2.5m, one stem poorly removed now a decaying stub, mower damage around base	discuss best practice mowing and strimming practice with contractor	asap	

size ranges: S1 to 5m, S2 5-10m, S3 10-15m, S4 15-20m and S5 over 20m

OHB's - overhanging branches